



Preliminary Information

PIT5605 Rattle Noise from 60 /40 Rear Seat

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2015 - 2017	All	All	All	All
GMC	Canyon	2015 - 2017	All	All	All	All
Involved Region or Country:		North America				
Additional RPO/s:		AJ2				
Condition:		Rattle noise from the rear 60/40 seat				
Cause:		Misalignment of the seat back latch				

Correction:

Inspect and adjust the rear seat using the information below.

Service Procedure:

Inspect the alignment of the bumpers in the latch in relation to the striker. (Illustration 1 below.)

 


Illustration #2 below shows both bumpers engaged .

 


Illustration #3 shows the latch aligned too far right , only one bumper engaged.

 
 
 


Illustration #4 shows latch aligned too far left , only one bumper engaged.



To align the striker to the insulators , loosen the nuts on the studs left and right shown below and move the seat left or right until centered.





Once aligned retorque the nuts on the studs to 45 Nm (33 lbs ft) and verify repair.

Warranty Information

Labor Operation:	Description:	Labor Time:
7080538	Adjust Rear Seat Latches	.3 hrs.

Version History

Version	1.0
Modified	Created on 12/18/17



© 2016 General Motors. All Rights Reserved.